



4G+ 56% 2:50 PM



mykonicaminolta.com



SSD Mobile Access



## RU-513, jam code 75-42 or 75-43

### *Known Error*

ID: **KBA00039440**

Related Products:**bizhub C368,bizhub 224e,bizhub 284e,bizhub 308,bizhub 308e,bizhub 364e,bizhub 368,bizhub 368e,bizhub 454e,bizhub 458,bizhub 458e,bizhub 554e,bizhub 558,bizhub 558e,bizhub 654,bizhub 654e,bizhub 658e,bizhub 754,bizhub 754e,bizhub C224,bizhub C224e,bizhub C284,bizhub C284e,bizhub C308,bizhub C364,bizhub C364e,bizhub C454,bizhub C454e,bizhub C458,bizhub C554,bizhub C554e,bizhub C558,bizhub C654,bizhub C654e,bizhub C658,bizhub C754,bizhub C754e**  
Related Options: **RU-513**


## Field mod to RU-513 to Correct Jamming on Long Continuous Runs

You will need to obtain the following:

Adhesive felt tabs (1 per RU-513):



Washers as pictured (2 per RU-513):

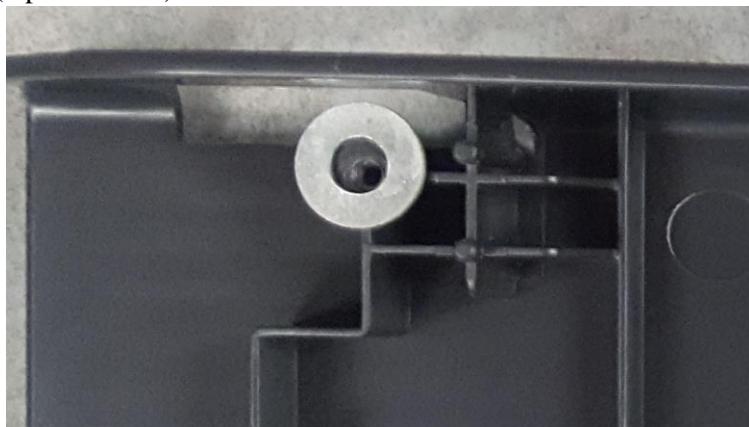

1. Disassemble the RU-513, separating the top cover from the base, by removing the rear hinge pin.
2. Separate the lid bottom from the top.
3. Remove the paper entry side hinge bracket from the lid (top cover) of the RU-513. This is the hinge closest to the fuser. Install a small washer under the bracket so that the screw passes through it.



4. After the hinge bracket is secured with the screw, insert another washer between the bracket and the plastic where the bracket protrudes out. The fit will be tight. Secure it in place with a piece of tape.



5. The hinge will look like this when completed. This picture was taken with the lid oriented improperly on the base. Ignore the rollers in the below pic.



6. Re-assemble the lid of the RU-513.
7. Affix a felt pad at the base of the hole where the top lid guide post rests.



8. Reassemble the RU and install into an MFP.
9. With the mods in place the top lid of the RU should be slightly elevated on the right side (paper entry).



10. Complete!