

I did a call on a 5002 w/an SC324. The rear brg was fine. The problem was, dev had entered the "nose cone" on the front and bound the unit.

This is something that we saw on a more regular basis w/earlier versions of this series, but it's the first time I've seen it on this model.

So, just pull the cover (one screw) and check this on each dev change.

If the unit is damaged, you can rebuild it with the following parts:

Auger, AD038091

Seal, AA153062

(2) Seal, AA152283

Bushing, AA080281

Gear, AB014062

Gear, AB014060

Gear, AB014061

Coupler, B0043078